



(19) Europäisches Patentamt
European Patent Office
Office européen des brevets



(11) EP 0 706 752 A1

(12) EUROPEAN PATENT APPLICATION

(43) Date of publication:
17.04.1996 Bulletin 1996/16

(51) Int. Cl.⁶: A01F 29/20

(21) Application number: 95202886.8

(22) Date of filing: 03.05.1988

(84) Designated Contracting States:
DE FR GB

(30) Priority: 05.05.1987 US 46011

(62) Application number of the earlier application in
accordance with Art. 76 EPC: 92202291.8

(71) Applicant: NEW HOLLAND BELGIUM N.V.
B-8210 Zedelgem (BE)

(72) Inventors:

- McClure, John R.
New Holland, Pennsylvania 17557 (US)
- Strosser, Richard P.
Akron, Pennsylvania 17501 (US)

- Chow, Marc K.
Leola, Pennsylvania 17540 (US)
- Weaver, Marvin G., Jr.
Lititz, Pennsylvania 17543 (US)
- Bohman, Carl E.
New Holland, Pennsylvania 17557 (US)

(74) Representative: Vandenbroucke, Alberic et al
New Holland Belgium NV.
Patent Department
Leon Claeysstraat, 3A
B-8210 Zedelgem (BE)


Remarks:

This application was filed on 25 - 10 - 1995 as a
divisional application to the application mentioned
under INID code 62.

(54) Shear bar adjustment apparatus including vibration sensor means with adjustable threshold

(57) Cutting apparatus having an adjustable shear bar (102) cooperable with a rotatable cutter head (100) to cut material passing between the shear bar and cutter head; said apparatus comprising an adjustment mechanism (110, 112, 116, 118, 122) for adjusting the clearance between the shear bar (102) and the cutter head (100) and including motor means (110, 112) operatively coupled to the shear bar (102), vibration sensor means (118) for sensing contact between the shear bar (102) and the cutter head (100) and electrical control means (116) operable to energise the motor means (110, 112) and responsive to the vibration sensor means (118) for automatically adjusting the shear bar (102) relative to the cutter head (100); said cutting apparatus

being characterised in that
the control means (116) comprises means for adapting
the threshold of the vibration sensor means (118) in
accordance with the level of background noise resulting
from normal operation of the apparatus so that vibrations
in the shear bar (102) resulting from contact between the
shear bar (102) and the rotating cutter head (100) are
distinguished from vibrations resulting from said back-
ground noise.

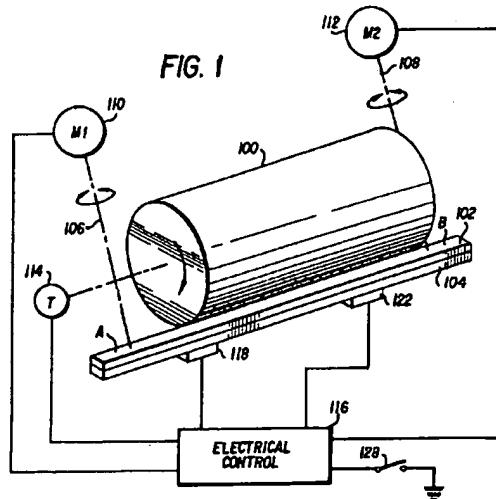

EP 0 706 752 A1

Description

The present invention relates to a cutting apparatus according to the preamble of claim 1. Such apparatuses are known from FR-A-2.537.832.

US-A-4,436,248 and US-A-4,678,130 each disclose an apparatus for manually adjusting the shear bar in a forage harvester relative to a rotating cutter head carrying a plurality of knives. In both patents, adjustment is accomplished by manually turning a first or a second knob, thereby to move a first or a second end of a shear bar. In actual practice, adjustment is carried out by turning the knobs and listening for the "tick" as the rotating cutter blades make contact with the shear bar. When the "tick" is heard, the shear bar is backed off until the sound is no longer heard. The adjustment is imprecise, time consuming, and requires that the operator leaves his seat to accomplish the adjustment. DE-A-2,926,538 discloses a similar manual adjustment for a single shear bar.

DE-A-3,345,749, which corresponds to FR-A-2,537,832, discloses the use of a motor for simultaneously driving linkages connected to both ends of a harvester shear bar automatically to adjust the shear bar relative to a rotating cutter head. Because both linkages are driven by a single motor, and are thus driven equally, it is not possible automatically to adjust the shear bar if it is not initially parallel to the cutter head and parallelism must be effected manually before the automatic adjustment may be accomplished. DE-A-3,535,902 discloses a similar arrangement based on a single, bidirectional motor and also discloses the use of opto-electrical means for sensing the gap between the shear bar and cutter head, and also the use of microprocessor control means.

In WO-A-82/01,299 a potential between a shear bar and a cutter head is monitored and a microprocessor controls a single motor to adjust the shear bar. In this device too, it is necessary that parallelism be first established by manual adjustment.

US-A-4,479,346 discloses a lawn mower in which automatic adjustment of the reel blade and bedknife is affected by a single electric motor. The relative position of the reel blade and the bedknife is sensed by monitoring means operable to monitor any electrical current passing between the reel blade and the bedknife. There is no monitoring or sensing of mechanical vibrations resulting from impact of the reel blade with the bedknife.

DE-A-3,010,416 discloses the use of an acoustic or optical non-contact sensor for monitoring the gap between the fixed and moving blades of a harvester. In this device the sensor monitors the gap between the fixed and moving blades by sensing the proximity of the moving blades and if the gap varies beyond predetermined limits, the harvester operation is stopped. No provision is made for utilising the sensor output to adjust the gap.

The present invention relates to an adjustment mechanism for automatically adjusting the clearance

between a fixed shear bar and a moving cutter head of a cutting apparatus such as used in a forage harvester and comprising vibration sensor means for detecting contact between the shear bar and the cutter head knives.

Background noise, that is the vibrations induced by normal harvester operation, is particularly troublesome in such arrangements wherein vibration sensors are utilised in the automatic shear bar adjustment system.

In accordance with the present invention, means are provided for adapting the threshold of the vibration detection system in accordance with the level of background noise so that vibrations resulting from contact between the shear bar and the rotating cutter blades may be reliably distinguished from vibrations resulting from normal harvester operation.

The sensitivity of the control circuit to output signals from the knock sensor may be adjusted by sensing the "noise" vibrations in the shear bar support and developing digital indication of the noise. During the adjusting procedure this digital indication is added to a safety factor value and the output of the knock sensor (after analog to digital conversion) is compared to the sum. Thus, the magnitude of the output signal from the knock sensor required to indicate impact between the shear bar and cutter head varies depending on the noise vibrations induced in the shear bar by normal harvester operation.

A machine in accordance with the present invention will now be described in greater detail, by way of example, with reference to the accompanying drawings, in which:-

Figure 1 schematically illustrates an adjustment control system for automatically controlling the adjustment of a shear bar relative to a rotating cutter head;

Figure 2 is a diagram useful in explaining the method of adjusting the shear bar;

Figure 3 illustrates the mounting of an impact element and a vibration sensor on a shear bar support; Figures 4A and 4B, when arranged as shown in Figure 4C, comprise a circuit diagram of the electrical controls for controlling the shear bar adjustment and the testing and sensitivity adjustment of the vibration sensor;

Figure 5 shows the knock sensor output circuits and the circuits for applying reference signals to the analog-to-digital converter;

Figure 6 shows the INITIALISE routine;

Figure 7 shows the READY routine;

Figure 8 shows the NMIR routine;

Figure 9 shows the TSTGEN routine;

Figures 10A and 10B show the GETNOI routine;

Figure 11 shows the PULOUT routine;

Figures 12A-12C show the ADJUST routine; and

Figure 13 shows the PULFOUT subroutine.

Figure 1 schematically illustrates a cutting apparatus comprising a rotating cutter head 100 and an adjust-

able but fixed shear bar 102. By way of example only, the cutting apparatus may be the cutter head and shear bar of a forage harvester as illustrated in US-A-4,678,130. The shear bar 102 is mounted on a support bar 104 but is movable with respect to the support bar by actuation of linkages such as a pair of lead screws 106, 108. The cutter head 100 carries a plurality of knives which, as the cutter head rotates, cooperate with the shear bar 102 to cut material passing between the cutter head and the shear bar.

A first bidirectional motor 110 drives lead screw 106 which is linked to a first end A of the shear bar. A second bidirectional motor 112 drives lead screw 108 which is linked to a second end B of the shear bar.

Adjustment of the shear bar 102 relative to the cutter head 100 is accomplished with the cutter head rotating. A tachometer 114 senses rotation of the cutter head shaft and produces a sequence of pulses indicating the cutter head speed which is applied to an electrical control circuit 116. Adjustment is accomplished by sensing vibrations, or the absence of vibrations in the support bar 104 resulting from contact, or the lack of contact, between the shear bar 102 and the knives of the rotating cutter head. A vibration sensor 118, which may be a crystal, is attached to the support bar 104. The support bar has an internally threaded hole 120 (Figure 3) for receiving a threaded mounting stud provided on the crystal mount.

Since adjustment is accomplished by sensing vibrations resulting from contact between the shear bar 102 and the knives of the cutter head 100, it is essential that shear bar adjustment not be attempted if the sensor 118 is not functioning. A solenoid-actuated knocker 122 is provided for determining the operability of the knock sensor. The knocker 122 has a threaded mounting stud which secures the knocker to an internally threaded hole 124 in the support bar 104. The solenoid has a spring-biased armature which carries an impact element 126 at its end. When the solenoid is energised it drives the impact element 126 into contact with the support bar 104, inducing vibrations in the support bar which are sensed by the sensor 118. The electrical control 116 pulses the knocker 122 and analyses the signals returned by the sensor 118.

A push-button switch 128 is provided on a control panel near the operator. Each time the operator actuates switch 128, the electrical control circuit 116 checks the operability of sensor 118 as well as its sensitivity, checks to determine that the cutter head 100 is rotating and selectively energises first one of the motors 110, 112 and then the other until the cutter bar 102 is essentially parallel to the cutter head 100 and spaced therefrom by no more than a small predetermined distance on the order of a few thousandths of an inch.

The electrical control circuits 116 are illustrated in Figures 4A and 4B and include a microprocessor 200, an EPROM 202, an analog-to-digital converter (ADC) 204, a peripheral interface adapter (PIA) 206, a versatile interface adapter (VIA) 208, an address decoder or

selector 210 and a watch dog circuit 212. All units except the watch dog circuit are interconnected by an 8-bit bidirectional data bus 214 and/or a 16-bit address bus 216.

Since the details of the VIA 208, microprocessor

5 200, EPROM 202, ADC 204, PIA 206, and address decoder 210 are well known in the art, they are not described in detail herein but a brief description of each is given below.

The microprocessor 200 may be a Motorola type

10 6802 microprocessor including an internal memory for limited storage of data during a processing operation. The microprocessor has eight input/output terminals D7-D0 which are connected to the data bus 214 and sixteen output terminals A15-A0 for supplying an address generated within the microprocessor to the address bus 216. When a data register within the microprocessor is loaded with a byte of data for application to the data bus the microprocessor drives the signal R/W on lead 218 to logic 0 and when the data register is to receive a byte of

15 20 data from the data bus the microprocessor causes the signal R/W to go to logic 1. When the microprocessor places an address on the address bus it generates the signal Valid Memory Address (VMA) on lead 220 and this signal is applied to the gating input of address decoder

25 210. The microprocessor outputs a single phase clock onto lead 222 from its E terminal.

Microprocessor 200 has a non-maskable interrupt

(NMI) input terminal. A low-going signal at this terminal causes the microprocessor 200 to initiate a non-maskable interrupt sequence. The microprocessor 200 also has a reset input terminal \bar{R} and when the signal on lead 230 goes to low the registers within the microprocessors are cleared and the microprocessor becomes inactive. When the signal at terminal \bar{R} goes high it causes the

35 microprocessor 200 to begin a restart sequence.

Address bus bits A15-A13 are connected to input terminals of the address decoder 210. Each time the microprocessor outputs a signal on lead 220, it enables the address decoder to decode the three address bits

40 40 and produce a signal on one of the leads 223-226. The lead 223 is connected to the \bar{CS}_2 input of VIA 208. Lead 224 is connected to the \bar{OE} and \bar{CE} inputs of EPROM 202. Lead 225 is connected to the \bar{CS} input of ADC 204 while lead 226 is connected to the \bar{CS}_2 input of PIA 206.

45 The EPROM 202 may be a type 2764 capable of storing 8K 8-bit bytes. When the signal on lead 224 is low the location in the EPROM specified by the address applied to the EPROM from bus 216 is accessed. The location is either written to from the microprocessor, or 50 read out to the microprocessor, depending upon whether the signal R/W is low or high, respectively. EPROM 202 stores data and the program which is executed by the microprocessor.

The VIA 208 may be a type 6522 such as that man-

55 ufactured by Rockwell or Synertek. As disclosed at page 2526-2530 of the publication IC Master 1980, published by United Technical Publications, the VIA 208 includes 16 addressable registers and interval timers or counters. These registers and interval timers are addressed by

applying an address from the four low order of bits of the address bus 216 to the register select input RS3-RS0. Data is read from, or entered into the registers and counters through data terminals D7-D0 which are connected to the data bus 214. The VIA is enabled only when the microprocessor outputs a hexadecimal address, the high order bits of which cause the address decoder 210 to produce a low signal on lead 223 which enables the chip select (CS2) input of the VIA. The register or counter which is accessed is determined by the four low order bits of the address bus which are applied to register select inputs RS3-RS0 of the VIA. The accessed register or counter is either read from or written into depending upon whether the microprocessor 200 outputs a high or low level signal, respectively, on lead 218 to R/W terminal of the VIA. The 02 input of the VIA is a clocking input and is used to trigger data transfers. It is connected by lead 222 to the E terminal of the microprocessor 200. All circuits within VIA 208 are reset when the signal RES on lead 230 goes low. The VIA 208 produces an output signal CB2 which is used for control purposes. The microprocessor program periodically sends a byte of control information to VIA 208 to toggle CB2 and pulse watch dog circuit 212. The watch dog circuit may be two monostable multivibrators connected in series. Periodic pulses produced on lead 232 by the VIA periodically reset the watch dog circuit so that its output remains inactive. If the program should fail to send signals to the VIA 208 so that lead 232 is pulsed, the watch dog circuit times out and emits an output signal to reset the microprocessor, the VIA and the PIA 206. The watch dog circuit 212 also has an input 234 which is derived from a monitoring circuit (not shown) which monitors the logic circuit supply voltage. If this voltage should vary outside predetermined limits the signal on lead 234 cause the watch dog circuit 212 to produce an output signal to reset the microprocessor, the PIA and the VIA. The 5V supply voltage for the circuits of Figures 4A and 4B may be derived from the 12V battery which supplies power for the harvester if it is self-propelled, or from the battery for the tractor which pulls the harvester.

VIA 208 has two 8-bit input/output ports PA and PB. The bit positions of the ports are individually programmable as either an input or an output. Two buses, collectively designated 231, connect PA and PB to external circuits shown in Figure 4B. The port A bus is connected to receive the outputs of a plurality of amplifiers 241-244. Amplifier 241 has one input connected to the 5V logic supply voltage and a second input connected through two resistors 248 and 250 to the 12V power supply. The junction between resistors 248 and 250 is connected through a switch 252 to ground. As long as switch 252 is closed the amplifier applies a logic 0 signal to the bus but when switch 252 is open the amplifier applies a logic 1 signal to the bus. The switch 252 is associated with an engage lever (not shown) which is actuated so that a chain drive causes the cutter head 100 to rotate. Switch 252 is thus closed when drive power is applied to the cutter head.

5 Amplifiers 242-244 are arranged in the same manner as amplifier 241, with switches 254 and 256 being associated with amplifiers 242 and 243, respectively, and switches 258 and 260 being associated with amplifier 244. These switches are all limit switches for sensing when the ends of the shear bar 102 have reached their limits of travel toward or away from the cutter head 100. Switches 254 and 256 are actuated when ends A and B, respectively, of the shear bar 102 are at their limit of travel 10 away from the cutter head 100. Switches 258 and 260 are connected in series so that amplifier 244 produces a logic 1 output when either switch is opened, i.e. when either end A or end B is at its limit of travel toward the cutter head 100. The limit switches 258, 260 are incorporated within the housings of motors 110 and 112 and are actuated by mechanical bidirectional counter mechanisms which count rotations of lead screws 106 and 108.

The tachometer 114 (Figure 1) produces a sequence of output pulses at a rate proportional to the speed of rotation of the cutter head 100. The pulses are applied over a lead 262 (Figure 4B) to one input of a comparator amplifier 264. A voltage divider comprising two resistors 266 and 268 is connected between 5V and ground, and a reference voltage is applied from the junction of the resistors to a second input of amplifier 264. When the tachometer produces an output pulse exceeding the magnitude of the reference voltage, amplifier 264 applies a logic 1 signal to bit position 6 of the B bus. These pulses are counted by a counter (timer 2) in VIA 208.

268. Five bits of port B of the VIA are connected by a B bus to five inverters 270-274. The outputs of inverters 270-273 are connected to the bases of grounded emitter transistors 280-284, respectively. The collectors of transistors 280-283 are connected to the 12V source through the coils of relays K2-K5, respectively, while the collector of transistor 284 is connected to the 12V source through an audible alarm 286.

40 The direction of rotation of motor 110 is controlled by the contacts of relays K2 and K3, only one of which may be energised at any given time. If relay K2 is energised the motor rotates in one direction to move end A (Figure 2) of the shear bar 102 inwardly toward the cutter head 100. The current flow path extends from 12V through contacts K2a, motor 110, normally closed contacts K3b and resistor 288 to ground. On the other hand, if relay K3 is energised, a circuit extends from the 12V source through contacts K3a, motor 110, contacts K2b and resistor 288 to ground. Since current flow is in the opposite direction through the motor, it rotates in the opposite direction to move end A of the shear bar 102 away from the cutter head 100. If neither relay K2 or K3 is energised, motor 110 does not rotate because contacts K2a and K3a are both open.

45

50

55

Relays K4 and K5 have normally open contacts K4a and K5a and normally closed contacts K4b and K5b. Relays K4 and K5 control the motor 112 in exactly the

same manner that motor 110 is controlled by relays K2 and K3.

Bit 7 of port B of VIA 208 is controlled by one of the timers in VIA 208. The timer (TIC) causes an interrupt pulse to appear at PB7 each time the counter is loaded, the delay between the loading of the counter and the occurrence of the pulses being determined by the value entered into the counter. PB7 is connected by a lead 235 to the NMI input of microprocessor 200 so that the program being executed by the microprocessor is interrupted periodically and a routine is executed to read the various switches and output various control signals to the VIA and PIA buses.

One bit of the PB bus is connected to a type 3548 PNP drive circuit. The output of the driver circuit is connected to ground through the solenoid of knocker 122. As subsequently explained, the solenoid is energised to induce vibrations in the shear bar 104 and the resulting vibrations sensed by sensor 118 are analyzed to determine its operability.

The PIA 206 may be a type 6821 peripheral interface adapter. This device is well known in the art and is generally similar to VIA 208 except that it does not include timers. PIA 206 has two 8-bit ports PA and PB connected to an A bus and a B bus, collectively illustrated as buses 300. The bit positions of the ports are individually programmable for input or output. Only 2-bit positions of port A are utilised and they are programmed as inputs. These bit positions receive the outputs of the two amplifiers 302 and 304. A quit switch 306 is connected between ground and one input of amplifier 302 so that when the switch is closed the amplifier applies a logic 1 signal to the PIA over the bus. Switch 306 is actuated to halt or interrupt a shear bar adjusting operation.

The switch 128 is connected to one input of amplifier 304 and when this switch is actuated the amplifier applies a logic 1 signal to the PIA over the bus. Switch 128 is the ADJUST switch which initiates a shear bar adjusting sequence.

Only seven bits of port B of PIA 206 are utilised and they are all programmed as outputs. Each bit is connected through a driver 310 and an LED 314 to 12V. The LEDs provide an operator with visual alarms or indications of the status of the system by indicating that the system is ready to begin an adjusting cycle; switch 306 has been actuated to interrupt an adjusting cycle; a motor 110 or 112 has stalled; the cutter head is not rotating; an end of travel has been reached; the sensor 118 is bad; or a shear bar adjusting operation is in progress.

ADC 204 may be a type 0844 converter such as that described at page 3537 of the publication IC Master, Vol. 2, 1984. The converter has four multiplexed input channels but only CH1, CH2 and CH4 are utilised in the present invention. The converter is enabled only when the address applied to selector 210 by microprocessor 200 causes the signal on lead 225 to be low. This lead is connected to the CS terminal of the converter.

The microprocessor 200 starts a converter cycle by placing a command on data bus 214 to select the chan-

nel, and driving lead 218 low. Lead 218 is connected to one input of two NANDs 320 and 322. The second input of NAND 320 is connected to +5V and the output of the NAND is connected to a further NAND 324. The E output of microprocessor 200 is connected to one input of NANDs 322 and 324 and the outputs of these NANDs are connected to the R and WR inputs, respectively, of the converter. When the signal on lead 218 is low, NAND 324 produces a low output when the clocking signal on lead 222 goes high. The output of NAND 324 enables the converter so that the operation specified by the command is carried out.

It takes the converter about 40 microseconds to convert an analog value to a digital value. The programming of microprocessor 200 is such that once it initiates a cycle of converter 204 it either waits or performs other operations until at least 40 microseconds have elapsed. The microprocessor 200 then places an address on bus 216 so that selector 210 produces a signal on lead 225 to select the converter. At the same time, the microprocessor 200 drives the signal on lead 218 high. When the clock signal on lead 222 goes high NAND 322 produces an output signal which enables the converter to place the converted value on bus 214 from whence it passes to the microprocessor 200.

The analog signal from knock sensor 118 is applied to the CH1 input of the A/D converter through a circuit (Figure 5) including resistors 328 and 329, amplifiers 330 and 332, a peak hold circuit 334 and a buffer amplifier 336. A pair of resistors 331, 333 provide a first reference voltage which is added to the knock sensor output signal, the output of amplifier 330 being proportional to the sum of the reference signal and the differential signal derived from the sensor. A second reference voltage is derived from a voltage divider comprising resistors 337 and 339. The second reference voltage is applied to an amplifier 340 and the output of the amplifier is tied to a junction 338 between the peak hold circuit 334 and buffer amplifier 336.

The output of amplifier 341 is also applied to the CH4 input of ADC 204. The ADC 204 is controlled to operate in a differential mode so that it determines the difference in the magnitude of the analog signals at CH1 and CH4 and converts this difference to a digital value for transmission to the microprocessor 200.

Resistors 343 and 345 form a voltage divider which is tapped to provide an input to an amplifier 346. The output of this amplifier is applied to the V_r input of ADC 204 to set the range of the converter.

During a shear bar adjusting operation motors 110 and 112 (Figure 4B) control the movement of the shear bar 102. As previously explained, the circuit for energising either motor 110, 112 in either direction extends through current sensing resistor 288. Thus, by sampling the voltage across the resistor 288 it is possible to determine if either motor is stalled or if the motor which should be running is not actually energised. The voltage developed across resistor 288 is applied through an operational amplifier 340, filter circuit 342, and buffer amplifier

344 to the CH2 input of ADC 204 where it may be sampled. The ADC does not subtract the magnitude of the CH4 signal from the CH2 before doing an ADC.

INITIALISE, READY and NMIR Routines

5

When power is turned on the microprocessor 200 automatically goes through an initialisation routine (Figure 6) during which the various registers and timers in the VIA and PIA are set up. This routine also clears the switch registers or locations in memory 202 which store indications of the last sampled state of the various switches. The routine then clears the QUIT, PULSW, and RPMOK flags and sets a FIRST flag. In addition, flags are set to turn off the alarm and alarm lights as well as the sensor light. The stack in the microprocessor 200 is initialised after which the program proceeds to the first step of the READY routine.

The READY routine is illustrated in Figure 7. It begins at step 700 by setting the flag POUTF. The ready light flag is set so that the ready light may be turned on when the NMIR routine is next executed. The sensor light flag is cleared so that the sensor light will be turned off the next time VIA 208 pulses the watchdog circuit 212. The BUSY and ALFLG flags are cleared after which the program proceeds to step 702 where it executes a wait for interrupt instruction. At about 2.5 ms intervals a pulse occurs at PB7 of the VIA 208 thereby pulsing the NMI input to microprocessor 200. The microprocessor interrupts the routine it is executing, in this case the READY routine, and executes the NMIR routine illustrated in Figure 8.

At step 800, the NMIR routine loads the counter TIC in VIA 208. This counter is decremented and when it reaches zero it will again pulse PB7 of the VIA to initiate another NMIR routine. The PIA next senses the QUIT and ADJUST switches and sets flags indicating which switches are actuated. In addition, if both switches are actuated a flag PULSW is set. The microprocessor then addresses the ADC 204 to initiate a read-convert cycle with CH2 as the selected input. This samples the motor current and converts it to a digital value.

At step 801 the CLFLG flag is tested to see if the clutch in the cutter head drive chain has been engaged to actuate clutch switch 252. If it has not, a flag is set to turn on one of the indicator lights 314 to indicate that the RPM of the cutter head is not within limits, and the program branches to step 812 to turn on the indicator. A return is then made to the routine which was interrupted.

If CLFLG indicates that the clutch is engaged, the program proceeds to step 802 where the FIRST flag is tested. This flag was set during the INIT routine so the program proceeds from step 802 to step 804 where FIRST is cleared and a value is set into RPMFLG. This value will be counted down to time the interval during which tachometer pulses produced by the cutter head tachometer 114 will be counted by timer 2 in VIA 208.

At step 806 RPMLFG is tested to see if the timing interval has elapsed. Assuming it has not, the program

decrements RPMFLG at step 808 and at step 810 the converted value of the current flowing through the shear bar adjusting motors is read from ADC 204 and saved. At step 812 the program sends data to PIA 206 to turn on the appropriate indicator lights. The program then returns to the routine which is interrupted to execute the instruction following the last instruction executed before the interrupt.

In Figure 7, steps 702 and 704 comprise a loop which is repeatedly executed until the test at step 704 indicates that a preset interval of time has elapsed. The program then tests the ADJSW flag at 706 and the PULSW flag at step 708. Assuming that the ADJUST switch is not actuated either alone or concurrently with the QUIT switch, the program executes another Wait For Interrupt at step 710 and then loops back to step 700. Thus, assuming the ADJUST switch is not actuated the READY routine is repeatedly executed, the routine being interrupted every 2.5 ms to execute the NMIR routine. Because FIRST is cleared at step 804 during the first execution of the NMIR routine after the cutter head clutch is engaged, the program branches from step 802 to 806 on the second and subsequent executions of the routine. RPMLFG is decremented at step 808 each time the NMIR routine is executed and after 255ms RPMFLG is reduced to zero. The test at step 806 proves true and the program moves to step 814 where the count of tachometer pulses accumulated by timer 2 in VIA 208 is read and saved, and RPMFLG is reloaded to time another 255ms interval.

RPMMIN is a value representing the minimum permissible rate of rotation of the cutter head 100. At step 816 RPMMIN is compared with count of tachometer pulses. If the count is equal to or greater than RPMMIN the RPMOK flag is set at step 818. If the count is less than RPMMIN then RPMOK is cleared at step 820. After step 818 or 820 the ADC 204 is addressed to again get the converted value of the adjusting motor current.

TSTGEN Subroutine

The purpose of the TSTGEN subroutine to check the operability of the knock sensor 118 and its associated circuitry. The TSTGEN subroutine is illustrated in Fig. 9 and begins at step 900 where TSTS is set to 3, SAMPLE is set to 64, and OKTST is cleared. At step 901 a value is sent to VIA which causes the VIA to output a signal over its B bus to energise driver 275 thereby energising the knocker solenoid 122. In Fig. 3, the clapper 126 is driven against support bar 104. This induces vibrations in the support bar which may be sensed by knock sensor 118 to produce an analog signal. This signal passes through the circuit of Fig. 5 and is applied to the CH1 input of ADC 204.

At step 902 the microprocessor addresses the ADC and starts a conversion cycle. At step 903 the microprocessor executes a delay loop waiting for 40 microseconds while the ADC samples the CH1 and CH4 inputs and converts the difference into a digital value. At step 904

the microprocessor addresses the ADC and saves the digital value which is an indication of the output of the knock sensor.

The program then enters a loop comprising steps 905-910. At step 905 another analog-to-digital conversion cycle is started, at step 906 the microprocessor waits for completion of the conversion cycle, and at step 907 the converted value is retrieved from the ADC. Step 908 compares the latest (next) sample value with the previously converted value saved and the larger of the two values is saved. The value of SAMPLES is decremented and tested at step 910 and if it is not decremented to zero the program loops back to step 905. Thus, for one test the knocker solenoid is pulsed once at step 901 to induce vibration into the shear bar support and the output of the knock sensor is sampled 64 times, the largest of the 64 samples being saved at step 909. After the 64th sample the test at step 910 proves true and the program proceeds to step 911 where the saved largest sample is compared with a value representing the minimum acceptable magnitude for the signal output of the knock sensor.

If the largest sample is greater than or equal to the minimum acceptable magnitude OKTST is incremented at step 912 before TSTS is decremented at step 913. If the largest sample is less than the minimum acceptable magnitude the program branches from step 911 to step 913 without incrementing OKTST.

At step 914 TSTS is sampled to see if it has been decremented to zero. If it has not, the program branches back to step 901 to again pulse the knocker and determine the largest of the next 64 samples taken of the output of the knock sensor.

After three tests have been completed the test at step 914 proves true and at step 915 OKTST is sampled to see if it is still zero. If it is not, it means that the knock sensor test was successful and found at least one sample larger than the required minimum value. If OKTST is still zero it means that the knock sensor is not sensitive enough to be used, or its output circuitry is not functioning properly. The program branches to step 916 to set flags to turn on an indicator 314 and the alarm 286. A jump is then made to an alarm routine to sound the alarm and turn off the motors. Although the ALARM routine is not illustrated, it may be noted that the program continuously executes a loop in the ALARM routine until the operator turns the power off and then on so that the program again executes the INITIALISE routine illustrated in Fig. 6.

The Get Noise Subroutine

The subroutine GETNOI is illustrated in Figs. 10A and 10B. During execution of this routine the output of the knock sensor is tested up to four times, each test comprising 4096 samples. The maximum number of tests is set at step 1000 and the number of samples is set at step 1009. The purpose of GETNOI is to determine the noise vibrations induced in the shear bar as a result

of normal machine operation, or more specifically the output of the knock sensor in response to these vibrations. The subroutine develops a digital indication of the noise and this digital indication is subsequently used in the ADJUST routine described below to set the sensitivity of the system to the output signal from the knock sensor.

At step 1001 the RPMOK flag is tested. This flag is set at step 818 of the NMIR routine if the cutter head speed is equal to or greater than the minimum speed represented by RPMMIN. If the cutter head is not up to speed the program branches to step 1002 where a flag is set to turn on the alarm. At step 1003 the program executes a Wait For Interrupt and after NMIR is executed to again sample the speed of the cutter head the program branches back to step 1001. The loop 1001-1003 is repeated until the speed of the cutter head is above the preselected minimum speed RPMMIN. When the speed is satisfactory the NMIR routine will set RMPOK and upon return to GETNOI the test at step 1001 will prove true. The program then turns off the alarm flag at step 1004 and at step 1005 jumps to the PULOUT subroutine, subsequently described, which controls the shear bar 102 adjusting motors 110 and 112 to move the shear bar away from the cutter head 100. This insures that there will be no contact between the cutter head and shear bar while the noise test is being made. Since the PULOUT routine energises only one motor each time it is executed, step 1005 actually represents two executions of the subroutine.

At step 1006 the program jumps to the TSTGEN subroutine to test the operability of the knock sensor and its output circuitry. At steps 1007 and 1008 the program waits for an interrupt and for any vibrations induced in the shear bar during TSTGEN to die out.

Step 1009 clears two locations designated HIGH and RAVG, and sets SAMPLES to 4096. The program then enters a loop comprising steps 1010-1014. At step 1010 the program jumps to a RDSENS subroutine. This subroutine is not illustrated but comprises steps equivalent to steps 902-904. That is, it starts a conversion cycle to sense and convert the output of the knock sensor (minus the input to CH4) to a digital value, waits until the conversion is completed, and reads the converted sensed value from the ADC. At step 1011 this sensed value is compared with HIGH and the larger value is saved at HIGH. Step 1012 adds the sensed value to RAVG which is an accumulated sum of all sensed values. At step 1013 SAMPLES is decremented and at step 1014 it is tested to see if 4096 samples have been taken. If not, the program loops back to step 1010.

When 4096 samples have been taken, the program saves the largest of the samples at DATA2. The value in RAVG is tested by dividing it by a fixed value and testing the quotient to see if it exceeds a limit. If it does, it is an indication that there is too much background noise so the program branches to step 1022.

The occurrence of too much noise is not the only reason a noise test may fail. If the highest value sensed

during the 4096 samples exceeds a predetermined maximum value it means that there is not enough "headroom". That is, when the output of the knock sensor resulting from contact between the cutter head and shear bar is added to the highest noise value, it will exceed the maximum input signal which the ADC can convert. The contents of HIGH are compared to MAXN and if MAXN is smaller the program branches to step 1022.

A noise test will also fail if the highest noise value sensed exceeds the average noise value of all the samples by more than a fixed value NMRG. RAVG is added to NMRG and saved at DATA3. HIGH is then compared to the resulting sum at step 1020 and if HIGH is greater the program branches to step 1022.

If a noise test fails for any reason, CYCLES is decremented at step 1022 and tested at step 1023. If it has been decremented to zero the program sets the alarm flag at step 1024 and jumps to the alarm routine. If four tests have not been completed the program branches from step 1023 back to step 1001.

If any test proves successful, then no further tests are made. If a test is successful then the test at step 1020 will prove false and the program proceeds to step 1021 where HIGH is added to MARG to obtain a "noise value". In effect, the ADJUST routine described below assumes that any output signal from the knock sensor less than this value is due to noise alone. The noise value is saved at NOI2, the POUTF flag is cleared, and a return is made to the calling routine.

PULOUT Subroutine

The PULOUT subroutine shown in Fig. 11 is called for the purpose of moving one end of the shear bar 102 out, i.e. away, from the cutter head 100 by a given amount. At the time the subroutine is called the microprocessor A register holds an indication of which motor 110 or 112 is to be energised and in what direction, and the X register holds a value CYCLES indicating how many 1/4-second intervals the motor is to be energised.

The subroutine begins at step 1100 by checking POUTF. If the flag is set the program branches to step 1102 where QSEC is loaded with a value indicating 1/4-second. QSEC is decremented at step 1113 each time the loop comprising steps 1105-1116 is executed, and reaches zero after 1/4 second.

At step 1103 the microprocessor sends the motor indication to the output register of VIA 208 controlling port B. A signal is produced on the B bus to energise one of the relays K3 or K5 so that one of the motors 110 or 112 is energised to begin moving one end of the shear bar 102 away from the cutter head 100.

At step 1104 two counter locations HCNTR and LCNTR are loaded with values for timing high current and low current intervals. The motor current is checked as subsequently described to see if it exceeds a predetermined maximum value (e.g. the motor is stalled) or is less than a predetermined minimum value (e.g. motor winding circuit is open). If it exceeds the maximum value for

5 an interval of time corresponding to the count set in HCNTR or is less than the minimum value for an interval of time corresponding to the count set in LCNTR, the subroutine is terminated and an alarm condition indicated.

At steps 1105 and 1106 the program executes a loop waiting for the motor circuit transients to die out. Each interrupt occurring during execution of the loop causes the NMIR routine to be executed and during its execution the motor current is sensed, converted to a digital value and saved, as explained with reference to Fig. 8. At step 1107 the saved current value is compared with a reference value to see if the current is too high. Assuming the motor current is not too high, HCNTR is reloaded at step 1108 to restart the high current timing interval.

At step 1109 the current value is compared to a minimum reference value to see if it is too low. Assuming it is not, LCNTR is reloaded at step 1110 to restart the low current timing interval. Steps 1111 and 1112 merely 20 waste time so that the loop comprising steps 1105-1114 takes .01 second. At step 1113 QSEC is decremented and at step 1114 it is tested to see if it has reached zero. Assuming it has not, the program branches back to step 1105 and repeats the loop.

After 1/4 second the test at step 1114 proves true so the program moves to step 1115 where QSEC is reloaded to time another 1/4 second interval, and CYCLES is decremented. CYCLES is then tested at step 1116 to see if the required number of 1/4 second intervals have elapsed. If not, the program branches back to step 1105. If the required number of 1/4 second intervals has elapsed then the required movement of the motor is complete. At step 1117 the microprocessor sends a value to the output register of VIA 208 which turns off any motor that is on. A return is then made to the calling routine.V

40 If the test at step 1100 shows that POUTF is not set then the program tests the EOTOUT flag to see if either of the limit switches 254 or 256 is actuated. If either limit switch is actuated the program branches to step 1117, turns the motor off, and returns to the calling routine.

45 If the test at step 1107 shows that the motor current is too high, the program branches to step 1120 where HCNTR is decremented. HCNTR is then tested at 1121 to see if the high current condition has existed for too long a time. If it has not, the program moves to step 1111 and proceeds as described above. If the high current condition persists for too long a time, HCNTR will be decremented to zero and the test at step 1121 will prove true. In this case flags are set to turn on a stall indicator 314 and sound the alarm 286, after which the program jumps to the alarm routine.

55 Steps 1130-1132 serve the same purpose as steps 1120-1122 except that they time the interval the motor current is below the required minimum.

ADJUST Routine

The ADJUST routine controls the motors M1 and M2 to adjust the shear bar relative to the cutter head. The program jumps to the ADJUST routine from step 706 of the READY routine if the adjust switch 308 has been actuated. The ADJUST routine begins at step 1200 where the BUSY flag is set and the READY LIGHT flag is reset so that indicators 314 will properly indicate the status of the system. The location TIMS is set to 2. If energisations of the motors 110 and 112 result in impacts between the rotating cutter head 100 and the shear bar 102 TIMS is decremented and when TIMS=0 the adjustment is complete. Certain flags such as IMP1, IMP2 and HITFLG are cleared at step 1200.

At step 1201 EOTIN is tested to see if one of the switches 258 or 260 is actuated because one end of the shear bar 102 is at its limit of travel toward the cutter head 100. If neither switch is actuated step 1202 checks the RPMOK flag to be sure that the cutter head is rotating faster than a predetermined minimum speed. Assuming that the rpm is satisfactory the program clears the flag for setting the RPM indicator 314.

The program jumps at step 1204 to the TSTGEN subroutine to test the knock sensor 118 and its output circuitry as previously described. Upon the return from this subroutine the program jumps to the GETNOI subroutine to determine the background noise.

At step 1206 the microprocessor fetches M1IN and sets WICHMO to indicate that motor M1 is active. The program then obtains ONTIME, the number of 1/4 second intervals the motor M1 is to be energised. M1IN is then sent to VIA 208 and the VIA produces an output signal over its bus to energise relay K2 thereby energising motor M1 in a direction which moves end A (Fig. 2) of the shear bar 102 toward the cutter head 100.

Step 1208 sets QSEC to time 1/4 second. Steps 1209 and 1210 introduce a 100 ms delay to allow electrical transients resulting from the motor energisation to die down after which a jump is made to the RDSENS subroutine to sample the output of the knock sensor and convert it to a digital value. At step 1212, this value is compared with the value of NOI2 obtained during execution of GETNOI at step 1205. If the knock sensor output value is greater than NOI2 it indicates that the cutter head is hitting the shear bar so that program branches to Fig. 12C.

Assuming that the sensor output value is less than NOI2, no hit has occurred so the program proceeds from step 1212 to step 1213 where the motor current value obtained during the last execution of the NMIR routine is compared to a value representing the maximum allowable current. If the motor current does not exceed the maximum allowable value then at step 1215 it is compared with a value representing the minimum allowable current. It may be noted that steps 1213-1222 of the ADJUST routine correspond exactly with steps 1107-1113, 1120-1122 and 1130-1132 of the PULOUT subroutine described above.

If the checks of the motor current show that it is within the prescribed limits then at step 1224 the EOTIN flag is checked to see if the motor has driven the end of the shear bar to its inward limit of travel. If it has not, the 5 RPMOK flag is checked to see if the cutter head is still rotating. Assuming it is, QSEC is decremented at 1226 and then tested at 1227 to see if 1/4 second has elapsed.

If the test at step 1227 shows that 1/4 second has not elapsed then the program loops back to step 1211 and repeats the loop comprising steps 1211-1216 and 1224-1227. When 1/4 second has elapsed the test at step 1227 proves true and the program moves to step 1228 where it resets QSEC to time another quarter-second interval and decrements ONTIME, the number of 10 quarter second intervals that the motor is to be on. In a typical system ONTIME may be about 10 such intervals.

After ONTIME is decremented it is tested at step 1229 to see if the motor energising interval has expired. If it has not, the program loops back to step 1211. If the 20 energising interval has expired the program moves to step 1262 (Figure 12C) where the flags IMP1, IMP2 and HITFLAG are cleared. The program then proceeds to step 1230 (Figure 12D) where the microprocessor sends a code to VIA 208 which terminates the output signal for energising relay K2. When relay K2 opens motor M1 stops. A jump is then made to the TSTGEN subroutine to check the operation of the knock sensor before beginning the movement of the other motor. Upon the return from TSTGEN the location WICHMO is tested to see if 25 M1 or M2 was the motor whose movement was just completed. If WICHMO indicates M1 then at step 1233 it is set to indicate M2 and the code is obtained for controlling M2 to move the shear bar inwardly toward the cutter head. On the other hand, if the test at step 1232 should indicate that WICHMO is set to M2 then at step 1234 it is set to indicate M1 and a code is obtained for controlling M1 to move the shear bar inwardly. After completion of step 1233 or 1234 the program branches back to step 1207 (Fig. 12A) where the code obtained at step 1233 or 1234 30 is sent to VIA 208 to energise either relay K2 or K4 and thereby activate motor M1 or M2 to move its end of the shear bar inwardly toward the cutter head.

Depending on the position of the shear bar at the time the adjusting procedure is initiated, M1 and M2 may 45 be alternately energised one or more times as described above without driving either end of the shear bar into contact with the rotating cutter bar. Eventually however energisation of one of the motors will result in contact. When RDSENS is executed at step 1211 to read the knock sensor output, this output will be larger than NOI2. Therefore, when the knock sensor output is compared to NOI2 at step 1212 the program recognises the hit and branches to step 1240 (Fig. 12C) where a code is sent to VIA 208 which deenergises all relays K2-K5 thereby 50 stopping all motors. At step 1241 WICHMO is checked to see which motor caused the hit. If it was M1 then the flag IMP1 is set at step 1242. IMP1 and IMP2 are checked at step 1243 to see if both have been set. If both IMP1 and IMP2 are set then HITFLG is set at 1244 before

step 1245 is executed. If IMP1 and IMP2 are not both set then the program branches from step 1243 to 1245.

At step 1245 the flag POUTF is cleared, the code for moving M1 outwardly is fetched to the microprocessor A register and BOUT, the number of quarter-second intervals the motor is to be energised, is loaded into the microprocessor X register. BOUT may be on the order of 5 such intervals. A jump is then made to the PULOUT subroutine to energise M1 in a direction to move the shear bar 102 away from the cutter head 100.

Upon return from the PULOUT subroutine HITFLG is tested. If it is not set, i.e. there has not been at least one impact by each of the motors, the program moves to step 1248 where the TSTGEN subroutine is executed to test the knock sensor. At step 1249 WICHMO is set to indicate M2, QSEC is reset to time a quarter-second interval, and the code is obtained for controlling the motor M2 to move the shear bar inwardly. The program then branches back to step 1207 where the motor is turned on by sending the code to the VIA 208.

Returning to step 1241, if the test shows that WICHMO is set to indicate M2 then the program branches to step 1252. Steps 1252-1259 correspond to steps 1242-1249 the only differences being that the flag IMP2 is set at step 1252, the code for energising M2 is obtained at step 1255, and WICHMO is set to M1 and the code for energising M1 is obtained at step 1259.

If a test at step 1247 or 1257 shows that HITFLG is set, the program then decrements TIMS at 1260 and tests it at 1261. If TIMS is not zero the program branches to 1262 to clear IMP1, IMP2 and HITFLG in preparation for checking for another set of impacts, one by each end of the shear bar. It then proceeds to Fig. 12D where the state of WICHMO is changed and the code for next energising one of the motors is obtained before branching back to step 1270 to energise the motor.

If the test at step 1261 proves true it means that the adjusting sequence is complete. A flag is set at step 1263 to beep the alarm 286, and the program then jumps to the READY routine.

It has been found that after two "hits", i.e. after impacts have twice caused HITFLG to be set, the shear bar is spaced on the order of .005 (0.127 mm) to 0.010 inch (0.254 mm) from the cutter head and essentially parallel thereto. The gap between the shear bar 102 and the cutter head 100 at the end of the adjusting procedure is governed in large part by the value of BOUT at step 1245 or 1255 which in turn controls the duration of motor energisation during the PULOUT subroutines at steps 1246 and 1256.

If the test at step 1201 or 1224 shows that the EOTIN flag is set, it means that one of the end of travel switches 258 or 260 is actuated because one end of the shear bar has been moved to its limit of travel toward the cutter head. In this case the program sets flags to turn on one of the indicators 314 to indicate EOT and sound an alarm, and then jumps to the ALARM routine. In like manner, if the RPMOK flag is not set when the test is made at step 1225, the programs sets appropriate flags to turn

on the RPM indicator and the alarm, and jumps to the ALARM routine.

At step 1202, the RPMOK flag is tested prior to any motor actuation. If the flag is not set the program sets flags for giving the alarm indication at step 1281 tests the QUIT flag to see if the operator has depressed the Quit switch. If he has, the program jumps to the READY routine. If he has not, a Wait for Interrupt is executed during the wait. The program then branches back to step 1202 to again check the RPMOK flag. If the cutter head is up to speed the program then clears the alarm flags at step 1203.

It will be recognised by those skilled in the art that by properly programming the VIA 208 so that some bus bit positions alternatively serve as input or output, it would be possible completely to dispense with the PIA 206. Thus, there is wide latitude in programming the control of the various indicators and alarms. For this reason the ALARM routine is not specifically described. The PIA 206 becomes necessary only when additional control features such as an automatic knife sharpener control are added into the system.

PULFOUT Routine

As previously indicated, the PULSW flag is set if the Quit and Adjust switches are actuated concurrently. By actuating both switches the operator may initiate the PULFOUT routine which moves each end of the shear bar 102 to its limit of travel away from the cutter head 100.

If the test at step 708 shows that PULSW is set the program jumps to the PULFOUT routine shown in Fig. 13. At step 1300 the Busy and POUTF flags are set, the length of time for energising the motor is loaded in the microprocessor X register, and the code for energising M1 to move the shear bar outwardly is entered in the A register. The program then jumps to the PULOUT subroutine to energise M1. Upon the return to PULFOUT EOTOUT1 is tested to see if end A of the shear bar is at its limit of travel. If not, the QUIT flag is tested at 1303. Assuming the Quit switch has not been actuated by the operator the microprocessor gets the control values for moving motor M2 outwardly (step 1304) and executes the PULOUT subroutine at step 1305 to move end B of the shear bar. Step 1306 tests EOTOUT2 to see if end B of the shear bar is at its limit of travel and if it is not the QUIT flag is tested at step 1307.

If the Quit switch is not depressed the program branches back to the beginning of the subroutine and continues executing the steps described above. When end A of the shear bar reaches its outward limit of travel the test at 1302 proves true and the program branches to turn off the motor (step 1308) and set the flag for beeping the alarm (step 1309). The program then jumps to the READY routine. The program also branches to step 1308 if the test at step 1306 indicates that end B of the shear bar is at its outward limit of travel.

The PULFOUT subroutine may be halted by depressing the Quit switch alone. This sets the QUIT flag

so that the program will branch from step 1303 or 1307 to step 1308, thus ending the pullout operation.

In summary, the present invention provides a completely automatic control for adjusting the position of a shear bar relative to a rotating cutter head by alternately energising first one and then the other motor alternately to move first one end of the shear bar and then the other. The system includes a knocker for inducing vibrations into the shear bar so that the operability of the knock sensor and its associated circuitry may be automatically checked. The system also automatically checks "noise" vibrations in the shear bar and adjusts the sensitivity of the system to the output signal from the knock sensor.

Claims

1. Cutting apparatus having an adjustable shear bar (102) cooperable with a rotatable cutter head (100) to cut material passing between the shear bar and the cutter head; said apparatus comprising an adjustment mechanism (110, 112, 116, 118, 122) for adjusting the clearance between the shear bar (102) and the cutter head (100) and including motor means (110, 112) operatively coupled to the shear bar (102), vibration sensor means (118) for sensing contact between the shear bar (102) and the cutter head (100) and electrical control means (116) operable to energise the motor means (110, 112) and responsive to the vibration sensor means (118) for automatically adjusting the shear bar (102) relative to the cutter head (100); said cutting apparatus being characterised in that

the control means (116) comprises means for adapting the threshold of the vibration sensor means (118) in accordance with the level of background noise resulting from normal operation of the apparatus so that vibrations in the shear bar (102) resulting from contact between the shear bar (102) and the rotating cutter head (100) are distinguished from vibrations resulting from said background noise.

2. Apparatus according to claim 1, characterised in that the control means (116) comprises an analog-to-digital converter (204) which is responsive to the vibration sensor means (118) for producing digital values indicative of the magnitude of the output signals produced by the vibration sensor means (118) in response to background noise in the shear bar (102) resulting from normal operation of the apparatus, respectively in response to vibrations in the shear bar (102) resulting from contact between the shear bar (102) and the rotating cutter head (100).

3. Apparatus according to claim 1 or 2, characterised in that the control means (116) is operable to sense said background noise in the shear bar (102) detected by the vibration sensor means (118), to develop a digital indication of this background noise, to add a safety factor value thereto to obtain a sen-

sitivity level value, to sample the vibration sensor output signal during shear bar adjustment for evidence of contact between the shear bar (102) and the cutter head (100) and to stop movement of the shear bar (102) towards the cutter head (100) when the sampled output signal exceeds the sensitivity level value.

- 5 4. Apparatus according to any of the preceding claims, characterised in that control means (116) are micro-processor controlled.
- 10 5. Apparatus according to any of the preceding claims, characterised in that the vibration sensor means (118) are operatively connected to support means (104) adjustably supporting the shear bar (102).
- 15 6. Apparatus according to any of the preceding claims, characterised in that the control means (116) includes means for sensing the magnitude of current flowing through the motor means (110, 112) and de-energising said motor means (110, 112) if the magnitude is above or below a predetermined range for a predetermined interval of time.
- 20 7. Apparatus according to any of the preceding claims, characterised in that the control means (116) includes means (114) for sensing the rate of rotation of the cutter head (100) and de-energising the motor means (110, 112) if the rate of the rotation is less than a predetermined minimum rate.
- 25 8. Apparatus according to claim 7, characterised in that the control means (116) repeatedly checks the rate of rotation of the cutter head (100) before and during the shear bar adjustment operation.
- 30 9. Apparatus according to any of the preceding claims, characterised in that the control means (116) includes means for automatically stopping movement of the shear bar (102) if the motor means (110, 112) operate for at least a certain time period without engagement between the shear bar (102) and the cutter head (100).
- 35 10. Apparatus according to claim 9, characterised in that said means for automatically stopping movement of the shear bar (102) comprise a counter, means for setting said counter to a first predetermined value, means for modifying the value in said counter at fixed intervals of time while said shear bar (102) is moving towards said cutter head (100) and means responsive to said counter when it contains a second predetermined value for deenergising the motor means (110, 112).
- 40 11. Apparatus according to any of the preceding claims, characterised in that the motor means comprise first and second motors (110, 112) and the control
- 45
- 50
- 55

means (116) comprise sequence control means for selectively energising the first and second motors (110, 112) to move the shear bar (102) relative to the cutter head (100).

5

10

15

20

25

30

35

40

45

50

55

FIG. 1

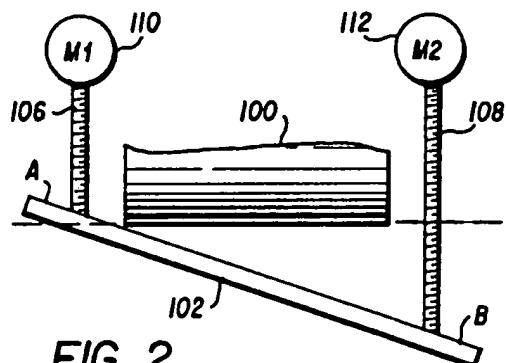
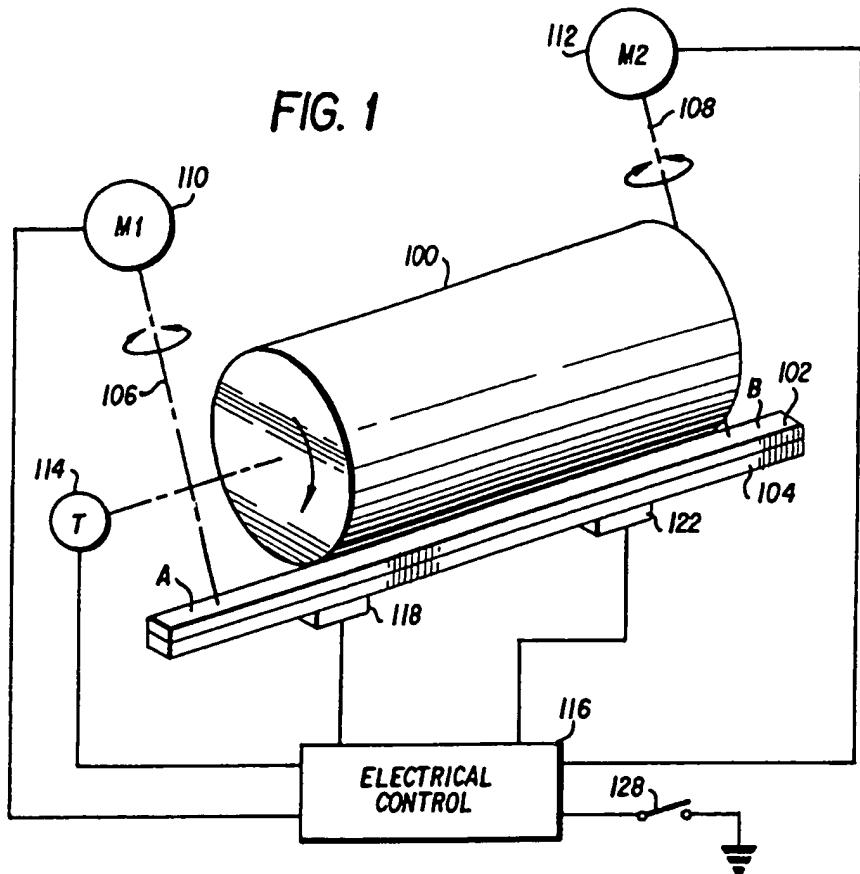


FIG. 2

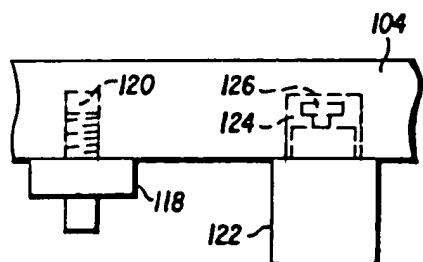


FIG. 3

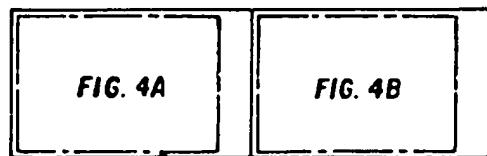
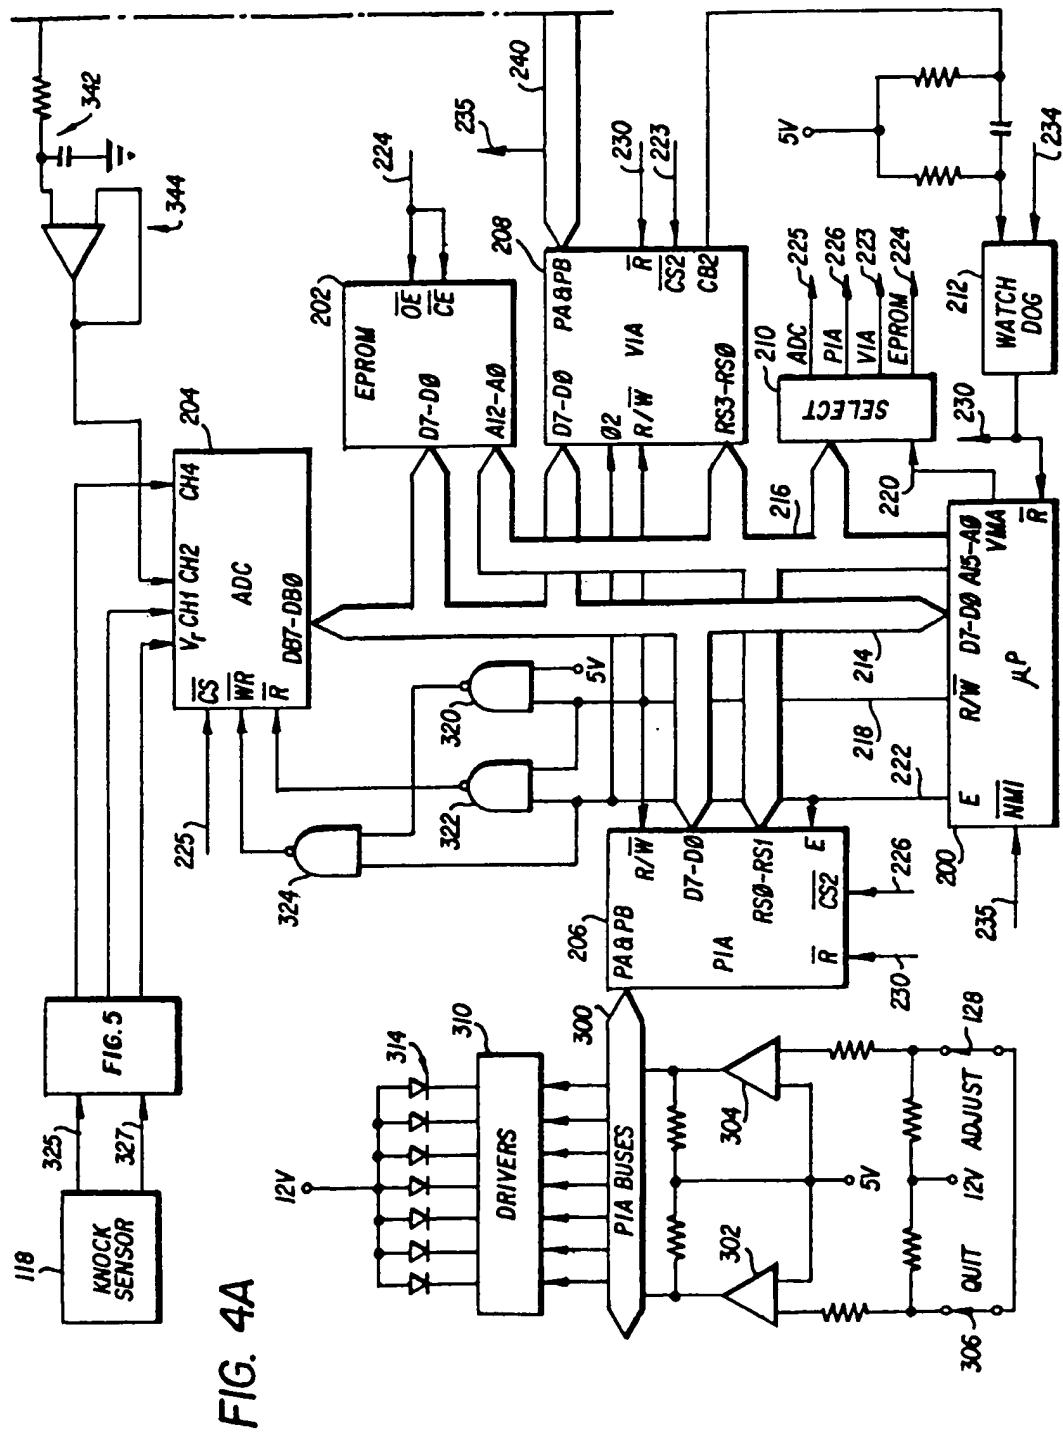
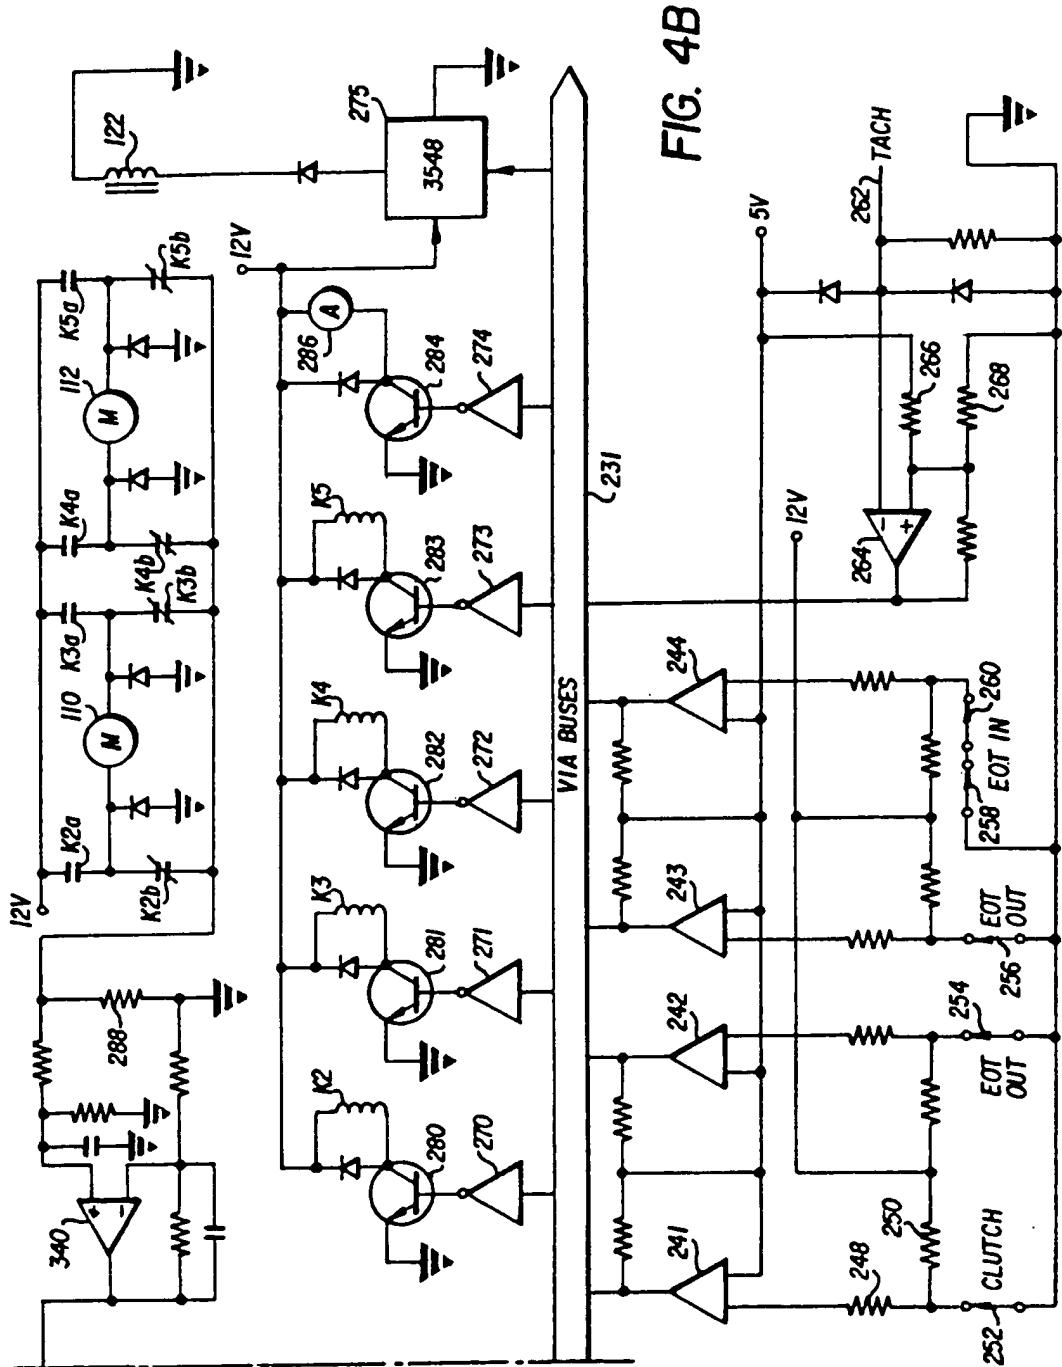


FIG. 4A

FIG. 4C

BEST AVAILABLE COPY





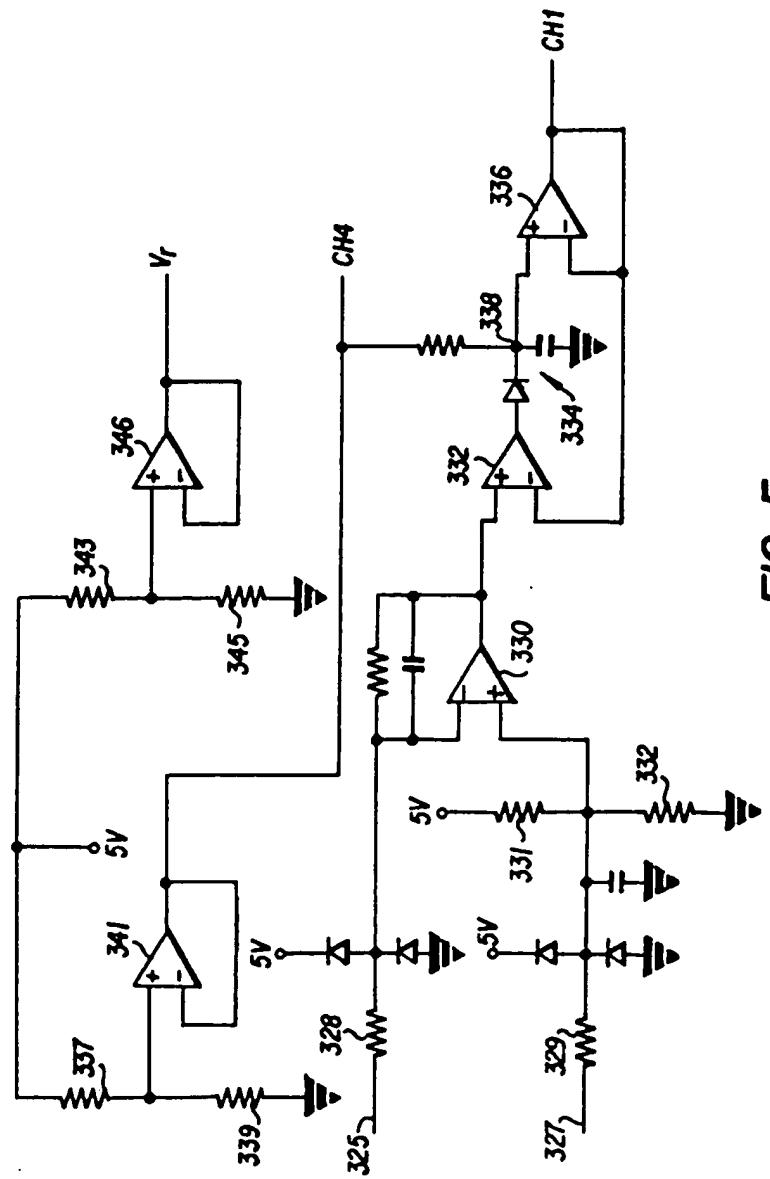


FIG. 5

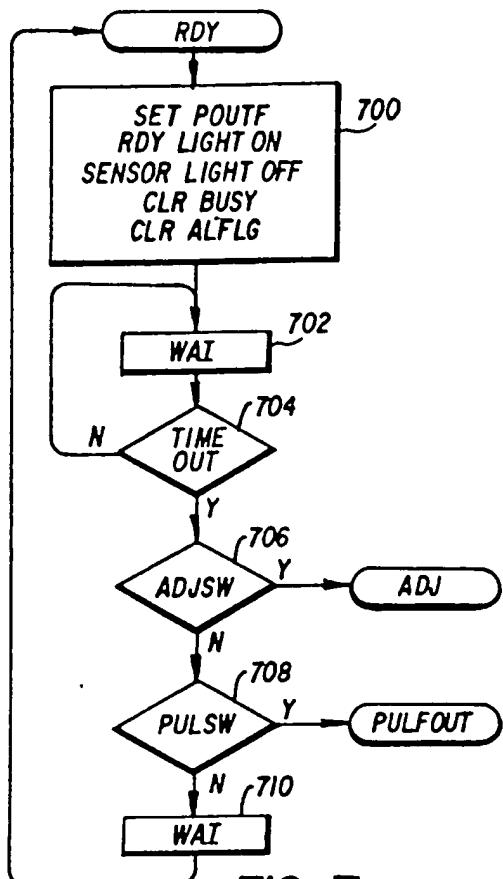


FIG. 7

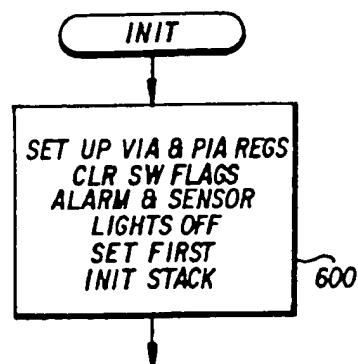
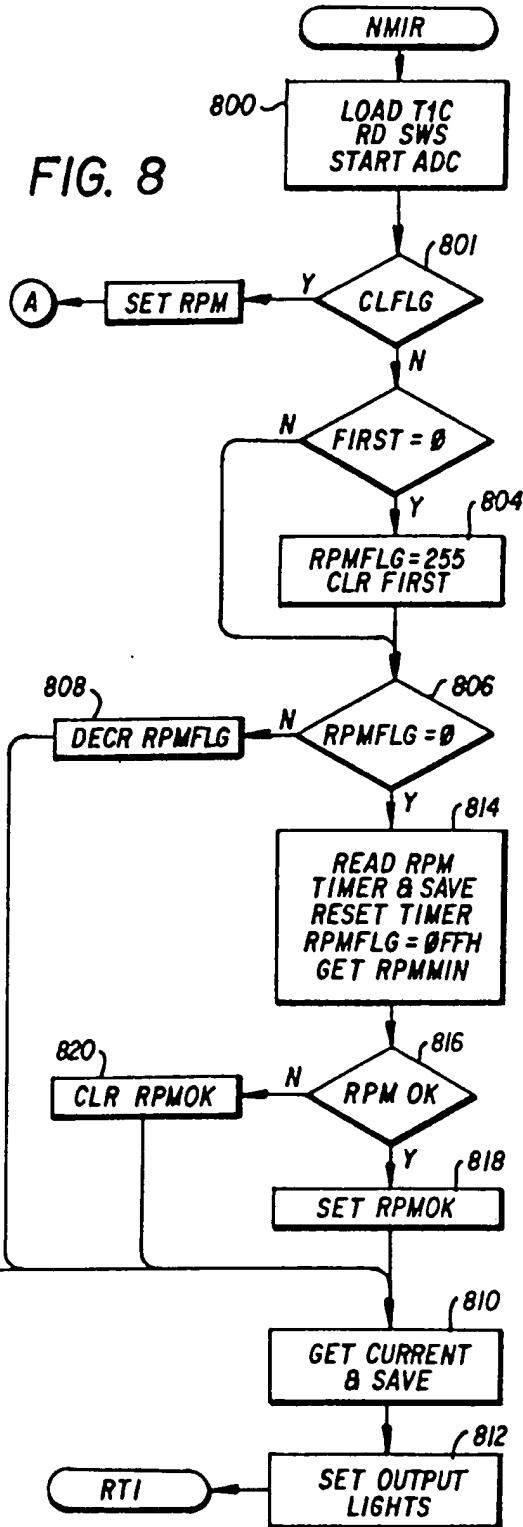


FIG. 6



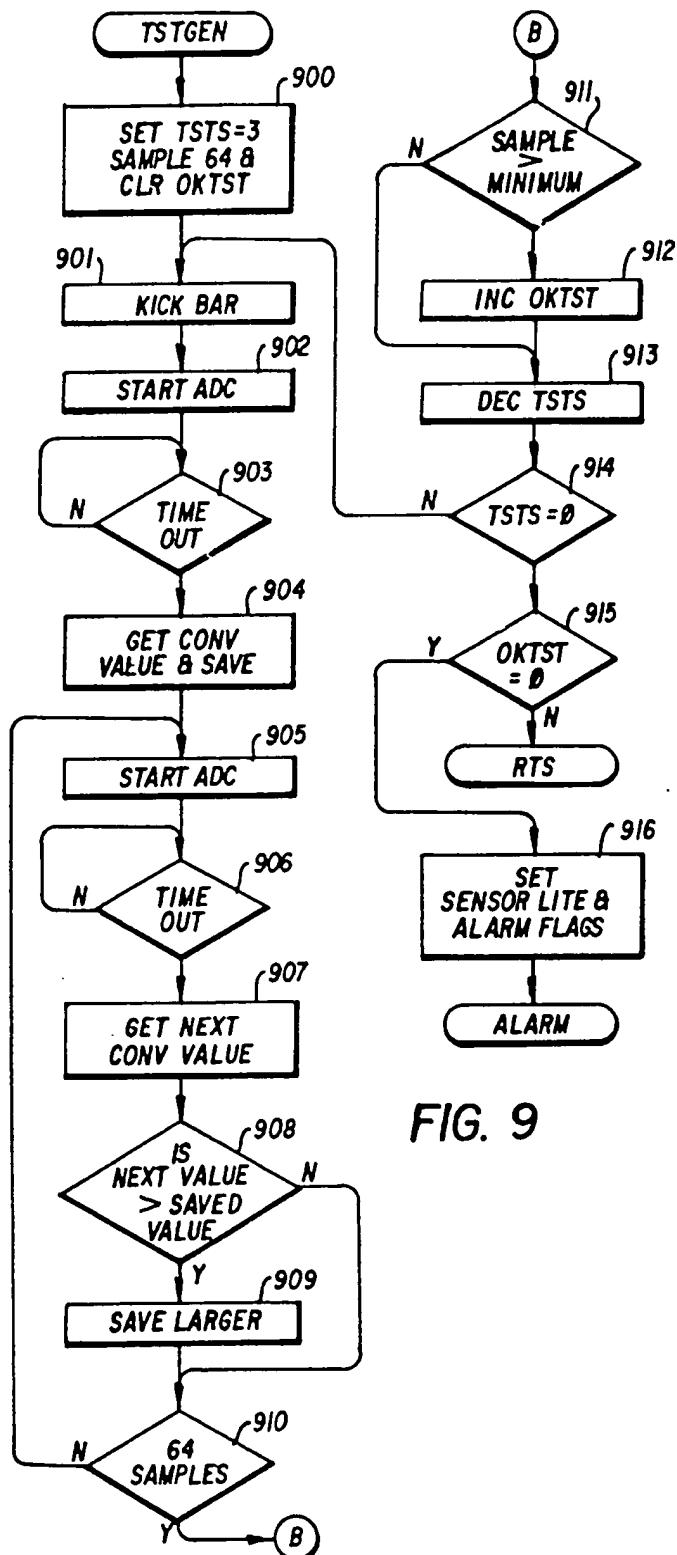


FIG. 9

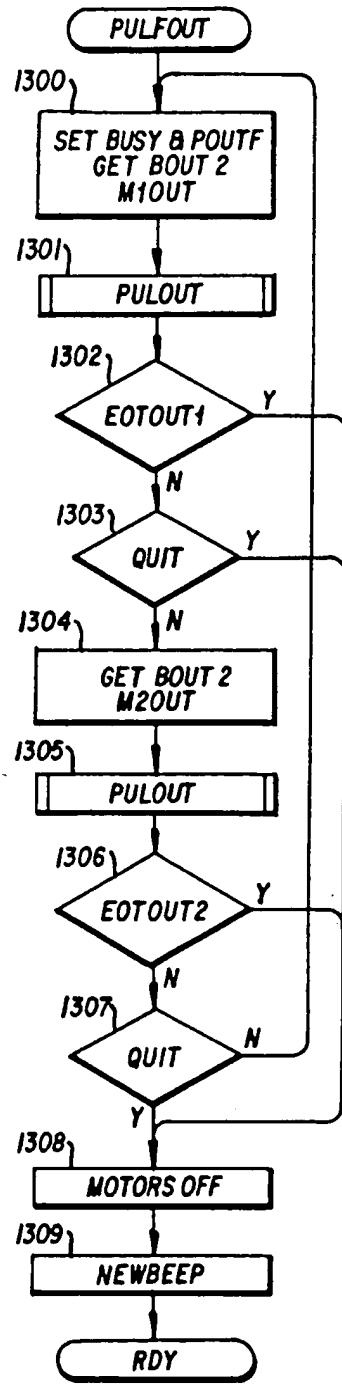


FIG. 13

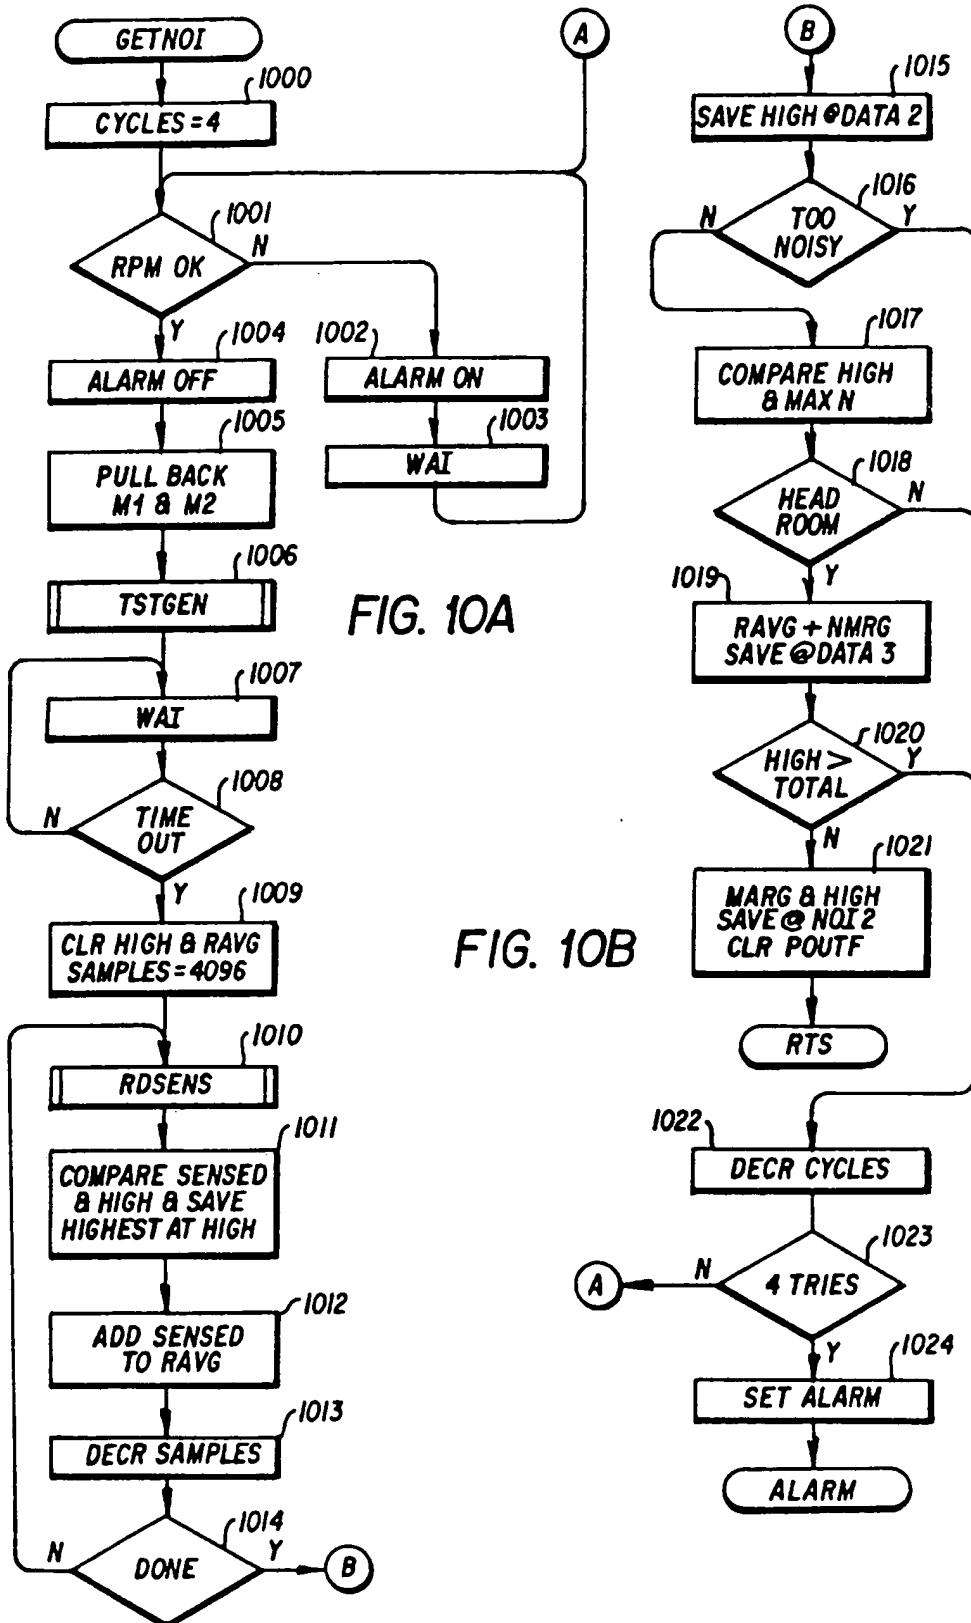
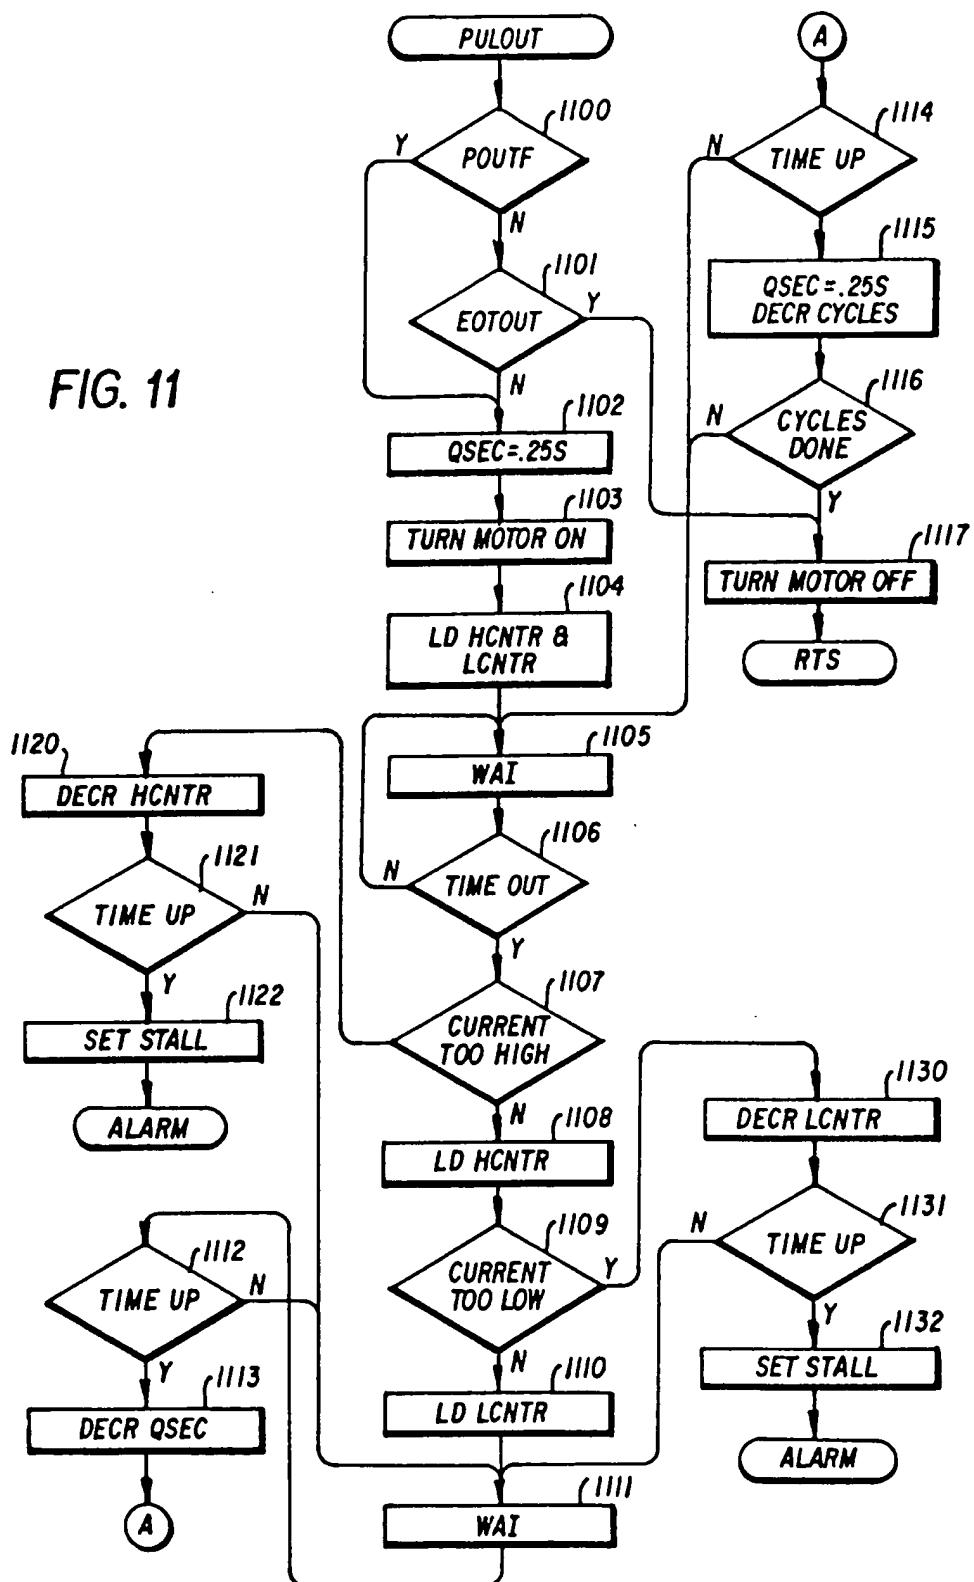


FIG. 11



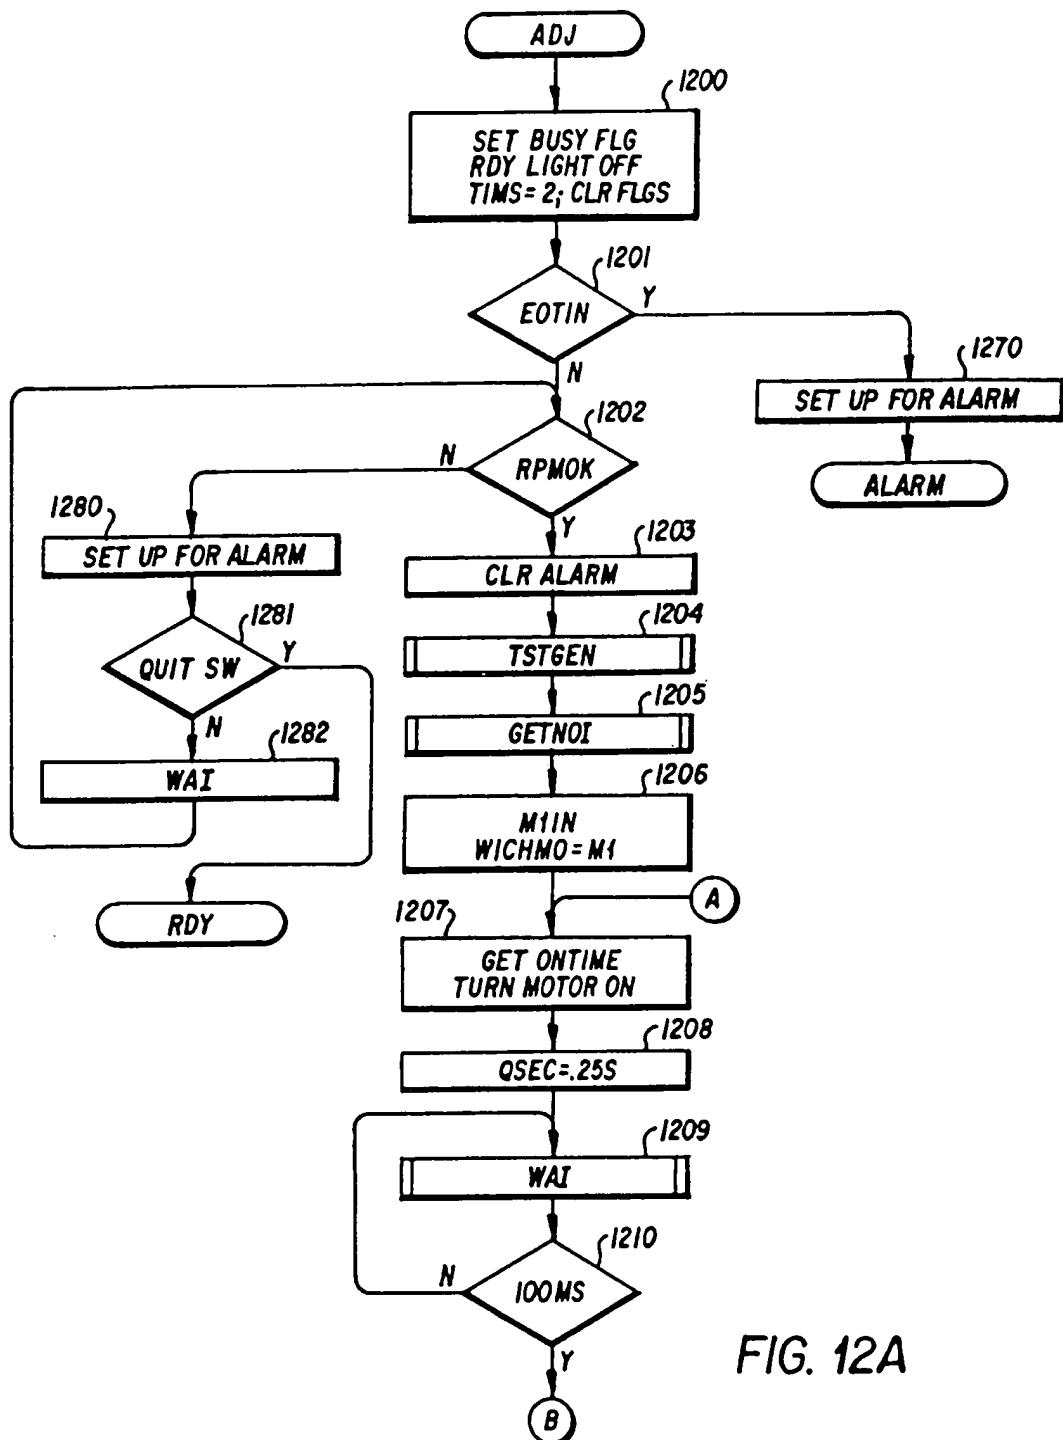
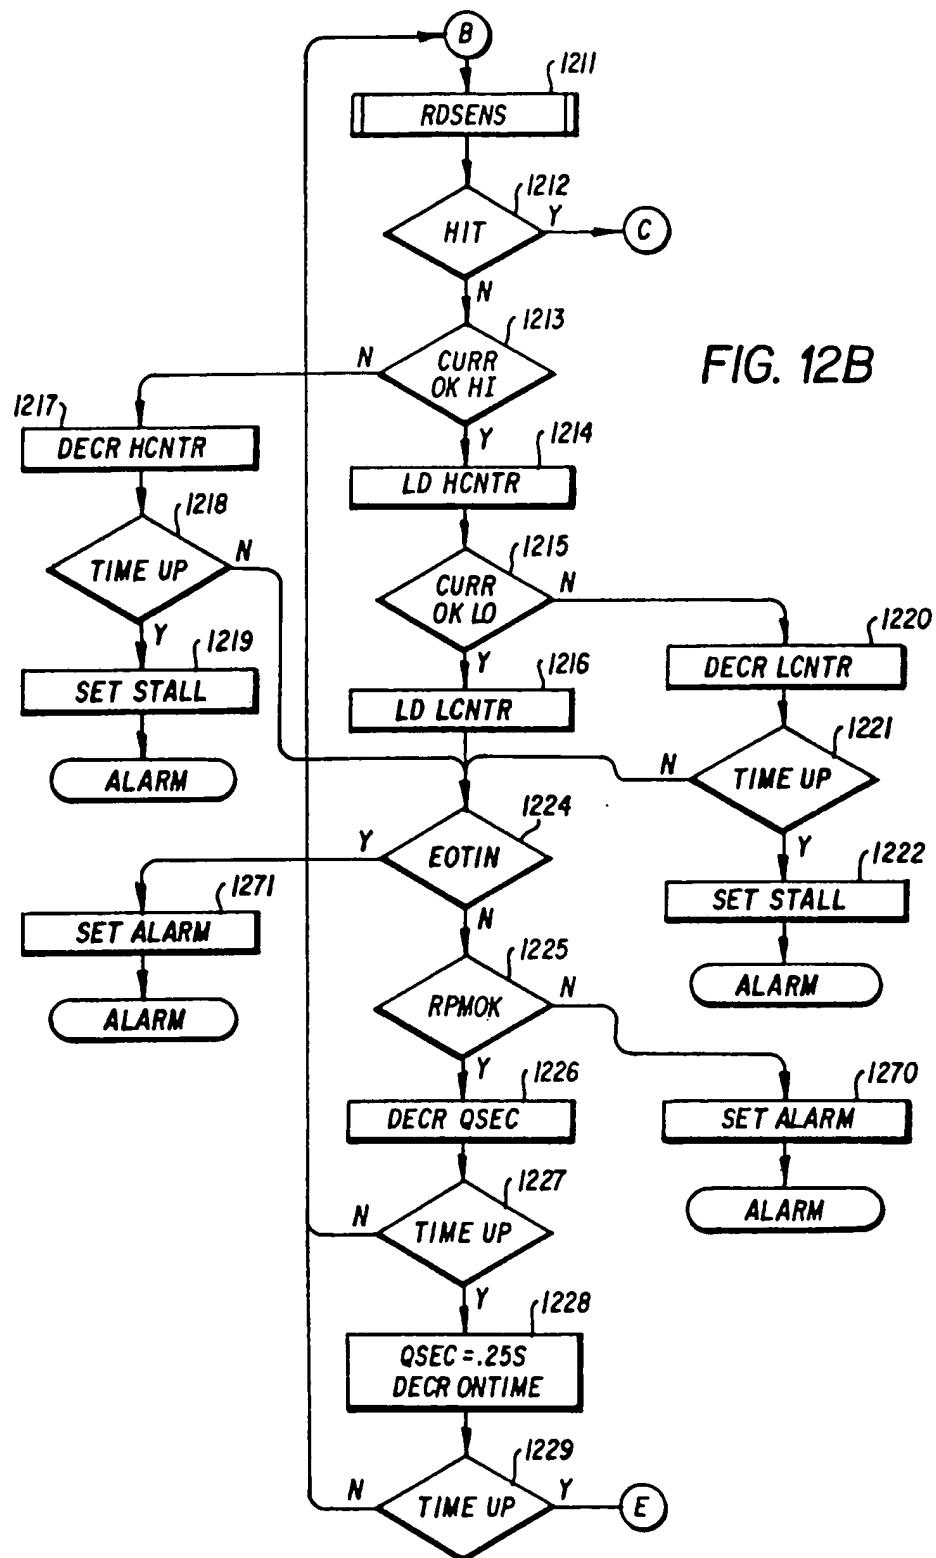


FIG. 12A

BEST AVAILABLE COPY



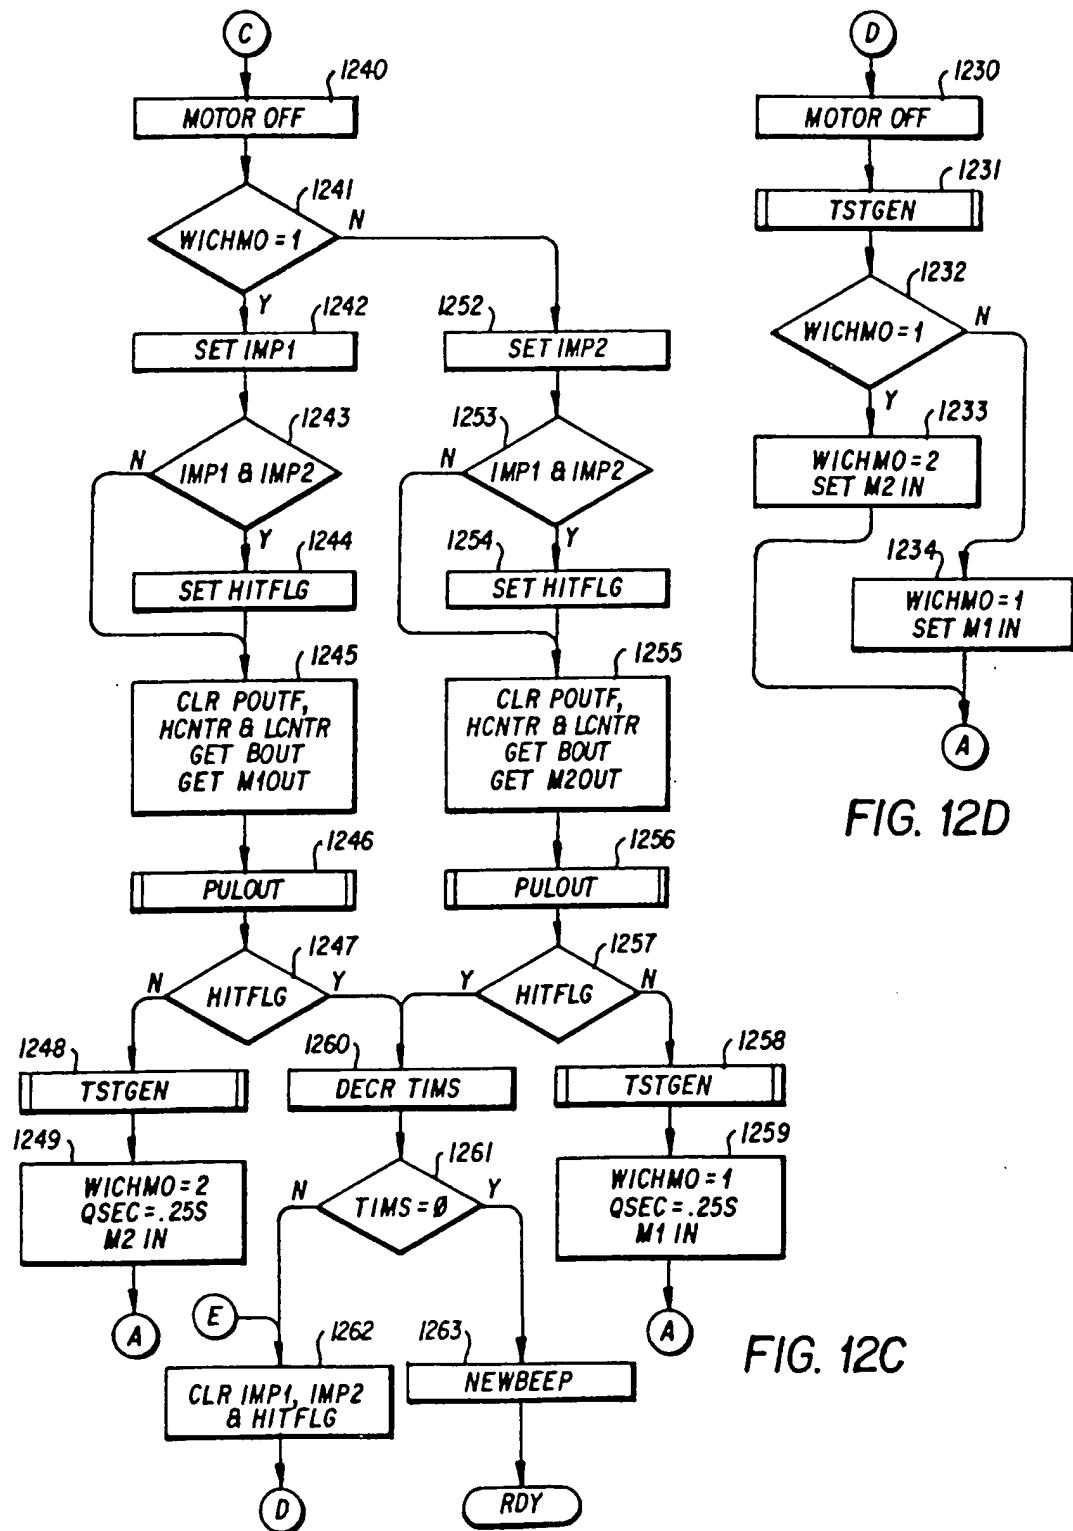


FIG. 12D

FIG. 12C



EUROPEAN SEARCH REPORT

Application Number
EP 95 20 2886

DOCUMENTS CONSIDERED TO BE RELEVANT			CLASSIFICATION OF THE APPLICATION (Int.Cl.)
Category	Citation of document with indication, where appropriate, of relevant passages	Relevant to claim	
D, A	DE-A-33 45 749 (HESSTON) * the whole document *	1, 6, 8-11	A01F29/20
D, A	US-A-4 479 346 (CHANDLER) * the whole document *	1, 6, 9, 10	
D, A	WO-A-82 01299 (THE TORO COMPANY)		
D, A	DE-A-30 10 416 (CLAAS)		
A	FR-A-2 440 541 (SPERRY CORPORATION)		
			TECHNICAL FIELDS SEARCHED (Int.Cl.)
			A01F A01D
<p>The present search report has been drawn up for all claims</p>			
Place of search	Date of completion of the search	Examiner	
THE HAGUE	8 February 1996	De Lameillieure, D	
CATEGORY OF CITED DOCUMENTS		T : theory or principle underlying the invention E : earlier patent document, but published on, or after the filing date D : document cited in the application L : document cited for other reasons & : member of the same patent family, corresponding document	
X : particularly relevant if taken alone Y : particularly relevant if combined with another document of the same category A : technological background O : non-written disclosure P : intermediate document			